


METAL ROOFING

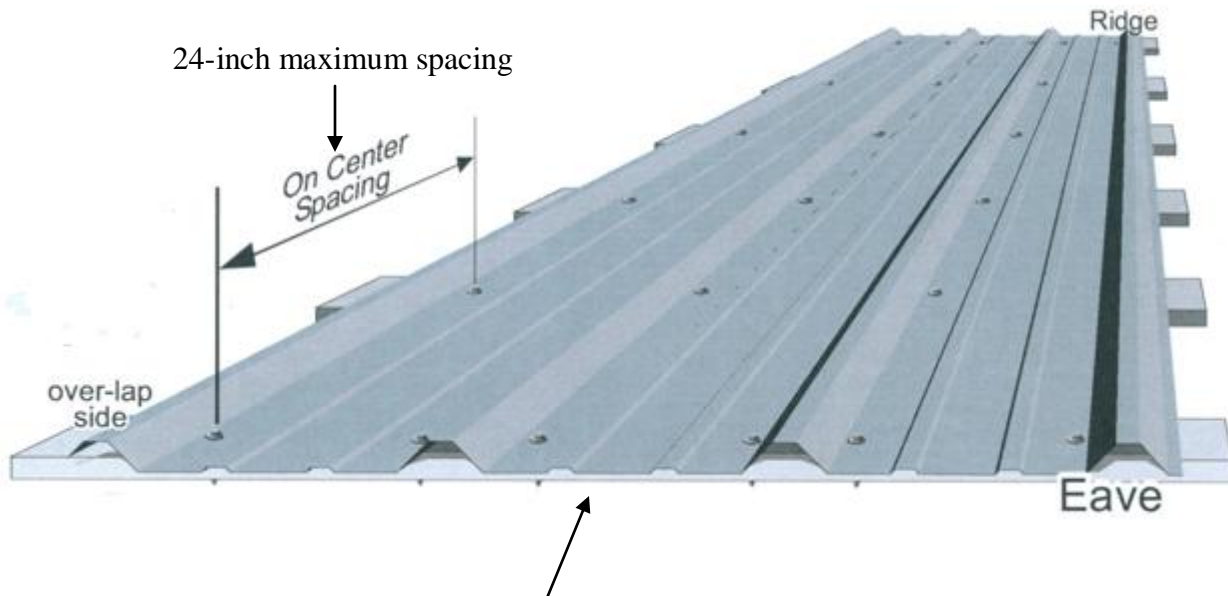

1. Screws should be placed on both sides of the ribs at both the eave and ridge, and on the overlap side of the panel lap (2 1/2" screws recommended).
2. Stripping must be a minimum of 1" x 4" pine (not pressure treated) spaced on a maximum 24-inch center.
3. Stripping must be fastened by one of the following methods:
 - a. #6 screws at 12-inch on center
 - b. 2 - 8d screw shank nails spaced 8-inch on center
 - c. 1 - 8d screw shank nail spaced 4-inch on center.
4. On roofs with less than 3/12 pitch, lap screws and butyl tape must be applied at the panel lap to keep water from overflowing the lap.

